



Fiat 500 Service Schedule Additional Procedure

Please be aware that within the scheduled servicing operations there has been added a specific check procedure for checking the condition of the front brake hoses on Fiat 500.

Please ensure that your service schedule documentation is updated to include this procedure.



See below for the details of the procedure:

1. Remove the brake pad wear sensor wiring (if any) from the housing.

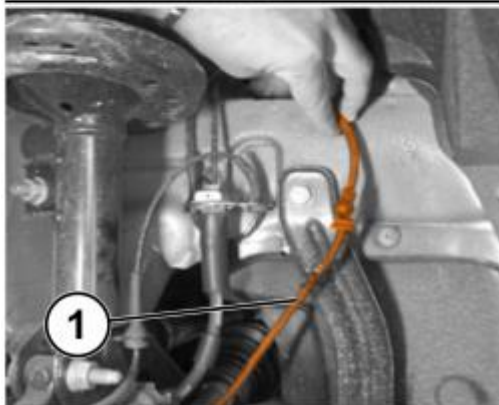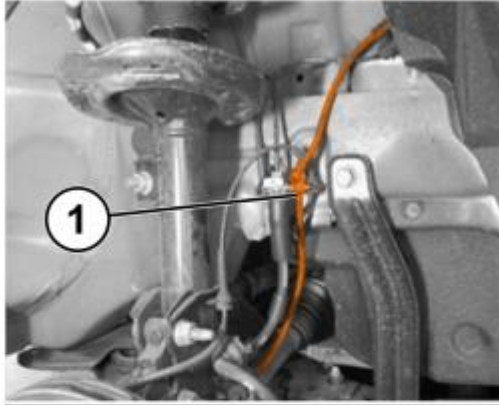


1. Move the rubber protection (1a) away until the connection (1b) of the brake hose line is completely uncovered.

 If necessary, use a suitable vice to facilitate the release of the protection

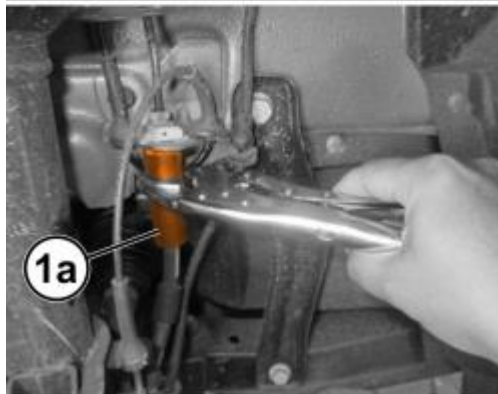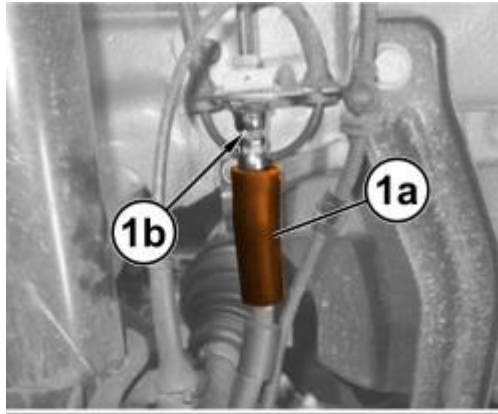

- Clean the fitting using "SOCOSAT A2501" wipes (or equivalent product).
- Blow compressed air onto the surface. Examine the brake hose connection.

3. If there is rust and the connector is NOT damaged, proceed as follows:- Apply the "LOCTITE SF 7500" anti-rust agent (or equivalent product) using a suitable brush, taking care to apply it also to the rear part of the fitting.- Wait 20 minutes for the product to dry and then restore rubber protection.

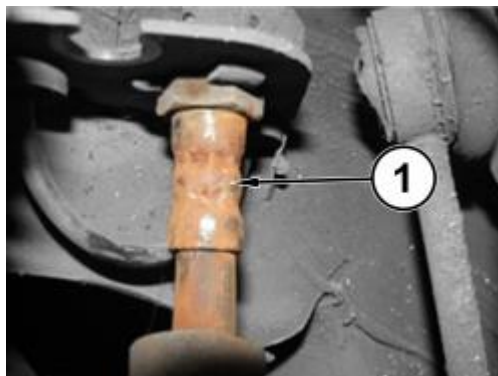

Jeep



4. In case of rust and or damage to the fitting, replace the hose as described in the relevant procedure.

